PAGE: 92

PRINT DATE: 09/14/95

FAILURE MODES EFFECTS ANALYSIS (FMEA) — CIL HARDWARE

NUMBER: MB-TMR-BM005-X

SUBSYSTEM NAME: MECHANICAL - EDS

REVISION:

9/1/95

PART NAME VENDOR NAME PART NUMBER VENDOR NUMBER

2

LRU

SRU

: GUIDE RING ASSEMBLY

33U.6271.011-05

NPO-ENERGIA

33U.6271.011-05

: ASSEMBLY, CAPTURE LATCH

330.6322.025

NPO-ENERGIA

330.6322.025

PART DATA

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS: CAPTURE LATCH ASSEMBLY

.

REFERENCE DESIGNATORS:

QUANTITY OF LIKE ITEMS: 3 THREE (ONE PER GUIDE PEDAL)

FUNCTION:

THREE ACTIVE (CAPTURE) LATCHES, ONE ON EACH GUIDE PEDAL OF THE CREITER DOCKING RING, PROVIDES POSITIVE CAPTURE TO THREE PASSIVE (BODY MOUNTED) LATCHES LOCATED ON THE MIR DOCKING MECHANISM. CAPTURE LATCH ROLLER MECHANISMS MOVE ASIDE DURING CLOSING CONTACT WITH THEIR OPPOSING BODY MOUNTED LATCHES AND ARE SPRING DRIVEN TO LOCK AFTER PASSING THE THREE PASSIVE BODY LATCHES (LUGS). TWO ROLLER MECHANISMS LOCATED ON EACH CAPTURE LATCH ASSEMBLY PROVIDE A REDUNDANT MEANS OF CAPTURE.

UPON RECEIPT OF A "CLOSE CAPTURE LATCH" COMMAND, POWER IS APPLIED.
THROUGH REDUNDANT "LATCH MOTOR OPEN" SENSOR CONTACT SETS TO A SINGLE
ACTUATOR MOTOR TO EXTEND BOTH ROLLERS OF ONE CAPTURE LATCH ASSEMBLY.
A "LATCH INDICATION CLOSED" SENSOR ON EACH ACTUATOR SENSES THE CLOSED
POSITION OF THE LATCH AND SENDS REDUNDANT SIGNALS TO THE DOCKING
CONTROL PANEL VIA THE DSCU TO ILLUMINATE THE "LATCHES CLOSED" LIGHT WHEN
ALL THREE CAPTURE LATCHES ARE CLOSED.

UPON RECEIPT OF AN "OPEN CAPTURE LATCH", COMMAND (FOLLOWING COMPLETION OF THE DOCKING PROCESS), POWER IS APPLIED THROUGH REDUNDANT "LATCH MOTOR CLOSED" SENSOR CONTACT SETS TO A SINGLE ACTUATOR MOTOR TO RETRACT BOTH ROLLERS OF THE CAPTURE LATCH ASSEMBLY FOR UNDOCKING OF THE MIR AND ORBITER. A "LATCH INDICATION OPEN" SENSOR LOCATED ON EACH CAPTURE LATCH ACTUATOR SENSES THE OPEN POSITION OF THE LATCH AND SENDS REDUNDANT SIGNALS TO THE DSCU TO ILLUMINATE THE "LATCHES OPEN" INDICATOR LIGHT ON THE DOCKING CONTROL PANEL AND COMMAND RING TO RETRACT WHEN THE SENSOR ON ALL THREE CAPTURE LATCH ACTUATORS IS CLOSED.

PAGE: 93 PRINT DATE: 09/14/95

FAILURE MODES EFFECTS ANALYSIS (FMEA) — CIL HARDWARE NUMBER: M8-1MR-BM006-X

THE THIRD CONTACT SET OF EACH "LATCH INDICATION OPEN" AND "LATCH INDICATION CLOSED" SENSOR IS UTILIZED FOR GROUND MONITORING OF CAPTURE LATCH POSITION. CAPTURE LATCH "INITIAL POSITION" IS ALSO DOWNLINKED FOR GROUND MONITORING.

IN THE EVENT A CAPTURE LATCH FAILS TO OPEN, THE MANUAL LATCH/UNBLOCKING DEVICE CONTAINED BEHIND THE CAPTURE LATCH ASSEMBLY WILL PROVIDE MANUAL RELEASE OF THE LATCH. A BUTTON ON EACH SIDE OF THE DEVICE, WHEN DEPRESSED SIMULTANEOUSLY, WILL RELEASE LATCH CONTROL BY THE LATCH ACTUATOR, THUS ALLOWING BOTH CAPTURE LATCH ROLLERS TO RETRACT TO THEIR OPEN POSITION.

SERVICE IN BETWEEN FLIGHT AND MAINTENANCE CONTROL: VISUAL INSPECTION, SERVICEABILITY CONTOL, DOCKING WITH CALIBRATING DOCKING MECHANISM.

MAINTAINABILITY
REPAIR METHOD - REPLACEMENT.

REFERENCE DOCUMENTS: 33U.6322.025 33U.6271.011-05 PAGE: 95 PRINT DATE: 08/25/96

FAILURE MODES EFFECTS ANALYSIS (FMEA) — CIL FAILURE MODE

NUMBER: M8-1MR-BM005-04

REVISION#

9/1/95

SUBSYSTEM NAME: MECHANICAL - EDS

LAU: GUIDE RING ASSEMBLY

ITEM NAME: ASSEMBLY, CAPTURE LATCH

CRITICALITY OF THIS

FAILURE MODE: 2/2

FAILURE MODE:

JAMMED ROLLER IN EXTENDED POSITION

MISSION PHASE:

00

ON-ORBIT

VEHICLE/PAYLOAD/KIT EFFECTIVITY: 104 ATLANTIS

CAUSE

CONTAMINATION, STRUCTURAL FAILURE DUE TO MANUFACTURE/MATERIAL DEFECT

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

CRITICALITY 1R2 DURING INTACT ABORT ONLY (AVIONICS ONLY)? WA

REDUNDANCY SCREEN

A) N/A

B) N/A

C) N/A

PASS/FAIL RATIONALE:

A)

N/A

8}

N/A

C) N/A

METHOD OF FAULT DETECTION:

VISUAL OBSERVATION - THE INABILITY OR DIFFICULTY TO CAPTURE MAY INDICATE A CAPTURE LATCH JAMMED ROLLER CONDITION.

- FAILURE EFFECTS -

(A) SUBSYSTEM:

FAILURE OF CAPTURE LATCH ROLLER TO MOVE ASIDE WHEN IN CONTACT WITH ITS OPPOSING BODY MOUNTED LATCH ON THE MIR DOCKING MECHANISM. CAPTURE BETWEEN ORBITER DOCKING MECHANISM RING AND MIR DOCKING MECHANISM MAY NOT BE POSSIBLE.

(B) INTERFACING SUBSYSTEM(S):

NO EFFECT ON INTERFACING ORBITER SUBSYSTEMS.



PAGE: 96 PRINT DATE: 08/25/95

| FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL FAILURE MODE

NUMBER: M8-1MR-BM006-04

(C) MISSION:

WORST CASE, INABILITY TO CAPTURE FOLLOWING FIRST FAILURE RESULTING IN LOSS OF DOCKING AND SUBSEQUENT LOSS OF MISSION OBJECTIVES.

(D) CREW, VEHICLE, AND ELEMENT(S):

REPEATED ATTEMPTS AT CAPTURE, WITH A JAMMED ROLLER, COULD CAUSE SLIGHT DAMAGE TO BOTH ORBITER AND MIR DOCKING MECHANISMS.

(E) FUNCTIONAL CRITICALITY EFFECTS:

N/A

DESIGN CRITICALITY (PRIOR TO OPERATIONAL DOWNGRADE, DESCRIBED IN F): 2/2

(F) RATIONALE FOR CHITICALITY CATEGORY DOWNGRADE:
N/A (THERE ARE NO WORKAROUNDS TO CIRCUMVENT THIS FAILURE.)

.____

-DISPOSITION RATIONALS-

(A) DESIGN:

À JAMMED CAPTURE LATCH ROLLER IS CONSIDERED VERY REMOTE. THE CAPTURE LATCH ROLLER ASSEMBLY IS DESIGNED TO ALLOW EASE OF MOVEMENT WHEN CONTACTING THE OPPOSING BODY MOUNTED LATCH. THE CAPTURE LATCH ASSEMBLY IS COMPLETELY ENCASED TO PREVENT INTRODUCING CONTAMINATION LARGE ENOUGH TO CAUSE A JAMMING.

(B) TEST:

DOCKING MECHANISM ACCEPTANCE TESTS:

1. VIBRORESISTENT TEST - APDS SUBJECTED TO THE FOLLOWING VIBRATION LEVELS FOR 2 MINUTES PER AXIS:

FREQUENCY (HZ)	SPECTORAL DENSITY ACCELERATION
FROM 20 TC	INCREASING, 3DB OCTAVE TO 0.04G ² /HZ
FROM 80 TC	PERMANENT 0.04G ² /MZ
FROM 350 TO 2000	DECREASING 3DB OCTAVE WITH 0.04G2/HZ

SUBSEQUENT TO THIS TEST AN INSPECTION IS PERFORMED TO IDENTIFY BROKEN OR LOOSE HARDWARE.

- 2. DOCKING MECHANISM CHECKOUT (STATIC) TEST CAPTURE LATCH ROLLER OPERATION IS VERIFIED WHEN THE DM SIMULATOR COMES IN CONTACT WITH THE RING ASSEMBLY. THIS ASSURES CAPTURE OF THE LATCHES OF THE RING ASSEMBLY WITH THE BODY LATCHES OF THE SIMULATOR.
- 3. THERMO VACUUM TEST DOCKING OF THE MECHANISM IS THERMALLY CYCLED, UNDER LOAD CONDITIONS, FROM +20°C TO -50'-55°C TO +50'+55°C TO +20°C IN A VACUUM AT 10°4 TO 10°5 TORR. DWELL AT EACH TEMPERATURE AND BETWEEN OPERATIONS AT EACH TEMPERATURE IS A MINIMUM OF 60 MINUTES AFTER STABILIZATION. OPERATIONS INCLUDES PERFORMING CAPTURE. PROPER OPERATION OF THE CAPTURE LATCH ROLLERS IS VERIFIED FOR A TEMPERATURE RANGE OF -50°C'-55°C TO 50°C'-55°C.

FAILURE MODES EFFECTS ANALYSIS (FMEA) - CIL FAILURE MODE NUMBER: M8-1MR-8M05- 04

4. CONTROLLED DOCKING TEST - CONTROLLED DOCKING IS PERFORMED UNDER LOAD CONDITIONS. CAPTURE LATCH ROLLERS MOVE ASIDE DURING CAPTURE. THIS TEST WILL VERIFY PROPER OPERATION OF THE CAPTURE LATCH ROLLERS.

DOCKING MECHANISM QUALIFICATION TESTS:

 VIBRATION STRENGTH TEST - APDS SUBJECTED TO THE FOLLOWING VIBRATION LEVELS IN EACH AXIS FOR A 400 SECOND DURATION.

FREQUENCY (HZ)	SPECTORAL DENSITY ACCELERATION
FROM 20 TO 80	INCREASING, 3DB OCTAVE TO 0.067GZ/HZ
FROM 80 TO 350	CONSTANT 0.067GZ/HZ
FROM 350 TO 2000	DECREASING 308 OCTAVE WITH 0.067GZ/HZ

SUBSEQUENT TO THIS TEST AN INSPECTION IS PERFORMED TO IDENTIFY BROKEN OR LOOSE HARDWARE.

2. TRANSPORTABILITY STRENGTH TEST - SHIPPING LOADS ARE SIMULATED ON A VIBRATING TABLE TO VERIFY THAT THE DOCKING MECHANISM WILL NOT BE DAMAGED DURING SHIPMENT. THIS TEST IS CONDUCTED UNDER THE CONDITIONS CONTAINED IN THE FOLLOWING TABLE.

VIBRATION	VIBRATION		TOTAL TEST					
ACCELER	ACCELER	5-7 7-15 15-30 30-40 40-80 DURATIO						ATION
DIRECTION	AMPLITUDE		TEST	HR	MIN			
ALONG X-AXIS	1,4	-	4		_	_		4
	1.2	76	<u>.</u> 93	32	61	39	5	7
ALONG Y-AXIS	1.1		4	-		_		4
	1.0	13	18	7	10	7	-	53
ALONG Z-AXIS	1.1	-	4			-	-	4
	1.0	32	40	16	26	16	2	10

SUBSEQUENT TO THIS TEST AN INSPECTION IS PERFORMED TO IDENTIFY BROKEN OR LOGSE HARDWARE.

- 3. SHOCK AND SAWTOOTH LOADING STRENGTH TEST DOCKING MECHANISM IS SUBJECTED TO 20G TERMINAL SAWTOOTH SHOCK PULSES IN EACH AXIS, 3 PULSES IN EACH DIRECTION FOR A TOTAL OF 6 PULSES/AXIS. AFTER COMPLETION AN INSPECTION IS PERFORMED TO IDENTIFY BROKEN OR LOOSE HARDWARE.
- 4. APDS SERVICEABILITY TEST IN A SIX-DEGREE-OF-FREEDOM DYNAMIC TEST THE SIX-DEGREE-OF-FREEDOM DYNAMIC TEST VERIFIES APDS DOCKING AND
 UNDOCKING OPERATIONS UNDER CLOSE-TO-FULL-SCALE CONDITIONS. STATIC
 MOTION OF ENTITIES IS SIMULATED UNDER SPECIFIC INERTIAL AND
 GEOMETRICAL PARAMETERS FOR VARIOUS INITIAL CONDITIONS FOR
 MIR/SHUTTLE DOCKING. A TOTAL OF 20 DOCKINGS IS PERFORMED. THE
 ABILITY OF THE CAPTURE LATCH ROLLERS TO MOVE ASIDE WHEN IN CONTACT
 WITH THE OPPOSING BODY MOUNTED LATCH IS VERIFIED DURING CAPTURE OF
 EACH DOCKING SUBSEQUENT TO THIS TEST AN ENGINEERING INSPECTION IS
 PERFORMED TO IDENTIFY BROKEN OR LOOSE HARDWARE.

FAILURE MODES EFFECTS ANALYSIS (FMEA) — CIL FAILURE MODE, NUMBER: M8-1MR-8M008- 04

5. COLD AND HEAT RESISTANCE TEST - DOCKING OF THE MECHANISM IS THERMALLY CYCLED FROM +20°C TO +50′-55°C TO +50′+55°C TO +20°C IN A VACUUM AT 10⁻⁴ TO 10°⁵ TORR. DWELL AT EACH TEMPERATURE AND BETWEEN OPERATIONS AT EACH TEMPERATURE IS A MINIMUM OF 60 MINUTES AFTER STABILIZATION. CAPTURE LATCH ROLLER OPERATION IS VERIFIED DURING EACH DOCKING, AS SHOWN BELOW.

	DOCKING	SIMULATOR ROTATIONAL ANGLE		TEMP	VOLTAGE	PRESS INTEGRITY	
SEQ NO.	RATE,	PITCH	ROLL	- '-C	VOLTS	CHECKOUT	
1	0.10	D°	0°	25 +/-10	23	YES	
2	0.10	<u>-</u>	4.	25 +/-10	34	NC.	
		<u> </u>	4*	25 +/-10	27	NO NO	
. 3	0.12	4°	<u> </u>		27		
4*				+60+/-5	- =	YES	
4	0.10	4"	09	+50+/-5	27	YES	
5 <u>-</u>	<u> </u>			-(60+/-5)		YES	
	0.10	4	09	-(30+/-5)	27	YES	
6.				+60+/-5		YE8	
- 6	0.12	<u>0</u> ,	4°	+50+/-5	23	. YES	
7"				-(60+/-5)	****	YES	
7	0.10	ǰ	4°	-(30° +/-5)	23	YES	
8*	 			+60+/-5		YES	
8	0.12	4°	4°	50 +/-5	34	YE\$	
9-				-(60+/-5)		YES	
9	0.12	40	4º	-(30 +/-5)	34	YE8	
10*				+60+/-5		YES	
10	0.10	40	0"	+50+/-5	27	YES	
111"	 			-(60+/-5)		YES	
11	0.10	00	4°	-(30 +/-5)	27	YES	
12"	 		٠	+60+/-5	 -	YES	
12*	0.10	00	4°	+50+/-5	27	YES	
13*	 			-(60+/-5)	<u> </u>	YES	
13*	0.12	4°	4"	-(30 +/-5)	27	YES	
14*	-	`		+60+/-5	·	YE8	
14*	0.12	4*	4"	+50+/+5	27	YEŞ	
15"	0.12	4*	4°	+25+/-10	23	YE8	

"MC621-0087-2001, -4001, & -5001 CINLY

1

AFTER COMPLETION AN INSPECTION IS PERFORMED TO IDENTIFY BROKEN OR LOOSE HARDWARE.

6. TARGET SERVICE LIFE TEST - TESTS ARE PERFORMED TO VERIFY PROPER DOCKING AND UNDOCKING OPERATIONS OVER ITS LIFE OF 100 DOCKINGS. PROPER OPERATION OF THE CAPTURE LATCH ROLLERS IS VERIFIED DURING 100 DOCKING AND UNMATING CYCLES. AFTER COMPLETION AN INSPECTION IS PERFORMED TO IDENTIFY BROKEN OR LOOSE HARDWARE.

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE NUMBER: M8-1MR-BM006- 04

7. CONTROL DISASSEMBLY - UPON COMPLETION OF ALL QUAL TESTING THE DOCKING MECHANISM IS DISMANTLED AND CAPTURE LATCH ASSEMBLIES ARE CHECKED FOR EVIDENCE OF WEAR OR FAILURE.

OMRSD - TURNARQUND CHECKOUT TESTING IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD.

(C) INSPECTION:

RECEIVING INSPECTION

COMPONENTS ARE SUBJECTED TO A 100% RECEIVING INSPECTION PRIOR TO INSTALLATION.

CONTAMINATION CONTROL

CORROSION PROTECTION PROVISIONS AND CONTAMINATION CONTROL VERIFIED BY INSPECTION. CHECK OF ROOM CLEANLINESS, PARTS WASHING AND OTHER OPERATIONS OF THE TECHNOLOGICAL PROCESS WHICH PROVIDES CLEANLINESS ARE VERIFIED BY INSPECTION.

CRITICAL PROCESSES

ANODIZING, HEAT TREATING, SOLDERING, CHEMICAL PLATING, AND CURING VERIFIED BY INSPECTION.

ASSEMBLY/INSTALLATION:

TORQUE, ADJUSTMENTS AND TOLERANCES ACCORDING TO TECHNICAL REQUIREMENTS OF THE DRAWINGS ARE VERIFIED BY INSPECTION.

TESTING

ATP/QTP TESTING VERIFIED BY INSPECTION.

HANDLING/PACKAGING

HANDLING/PACKAGING PROCEDURES AND REQUIREMENT FOR SHIPMENT VERIFIED BY INSPECTION.

(D) FAILURE HISTORY:

DATA ON TEST FAILURES, UNEXPLAINED ANOMALIES, AND OTHER FAILURES EXPERIENCED DURING GROUND PROCESSING OF ODS DOCKING MECHANISMS CAN BE FOUND IN PRACA DATA BASE.

(E) OPERATIONAL USE:

NONE

- APPROVALS -

DESIGN ENGINEER

DESIGN MANAGER

M. NIKOLAYEVA

NASA SS/MA

NASA SSIMA

A. SOUBCHEY

NASA SUBSYSTEM MANAGER

Jan 1 Mi Manage